

Summary of List A actions for Holy Trinity from Quinquennial report 2020

December 2020 Quinquennial report reference	A list Action required within 2 years.	Action
B.04 North Side Extension a.	The tiled roof is in good condition but there is a problem with the rainwater disposal on the north side of the modern extension. It appears as though the water discharging off the nave roof overloads the gutter and overflows at the outlet. This could be resolved by rerouting/ extending the nave roof pipe down to the gulley, or alternatively introducing a lead flashing at the end to prevent overflow. The former is the more long-term solution.	Work in hand to replace/extend drainpipe
D.05 Tower East Elevation a.	The walling condition on this elevation is mixed: there are patches of poor pointing, open joints and eroded stones – see above right, but mostly the stones themselves are sound.	BB consulted Faculty being prepared
b.	At this stage the longevity of the stonework would benefit significantly from complete repointing with the repair of a few of the worst stones, including the lower right jamb stone to the belfry window – above lower rig	As above
D.13 Nave South Elevation b.	Two window cills are still in poor condition and need repair (see below)	
E.07 Middle Chamber /Belfry c.	There is an old crack under the roof beam bearing on the north side, this should be deeply repointed and monitored. Below right	
E.07 Middle Chamber /Belfry c.	The stonework to the walls is dark, one slight crack noted over the in filled arch on the south side that could be repointed with the above	